


**CU-A18CKE ,DKD**  
**CU-A24CKE ,DKD**  
**CU-A28BKP**

Подключить к клемме "P"  
 (коричневый провод)  
 реле компрессора внутр. блока

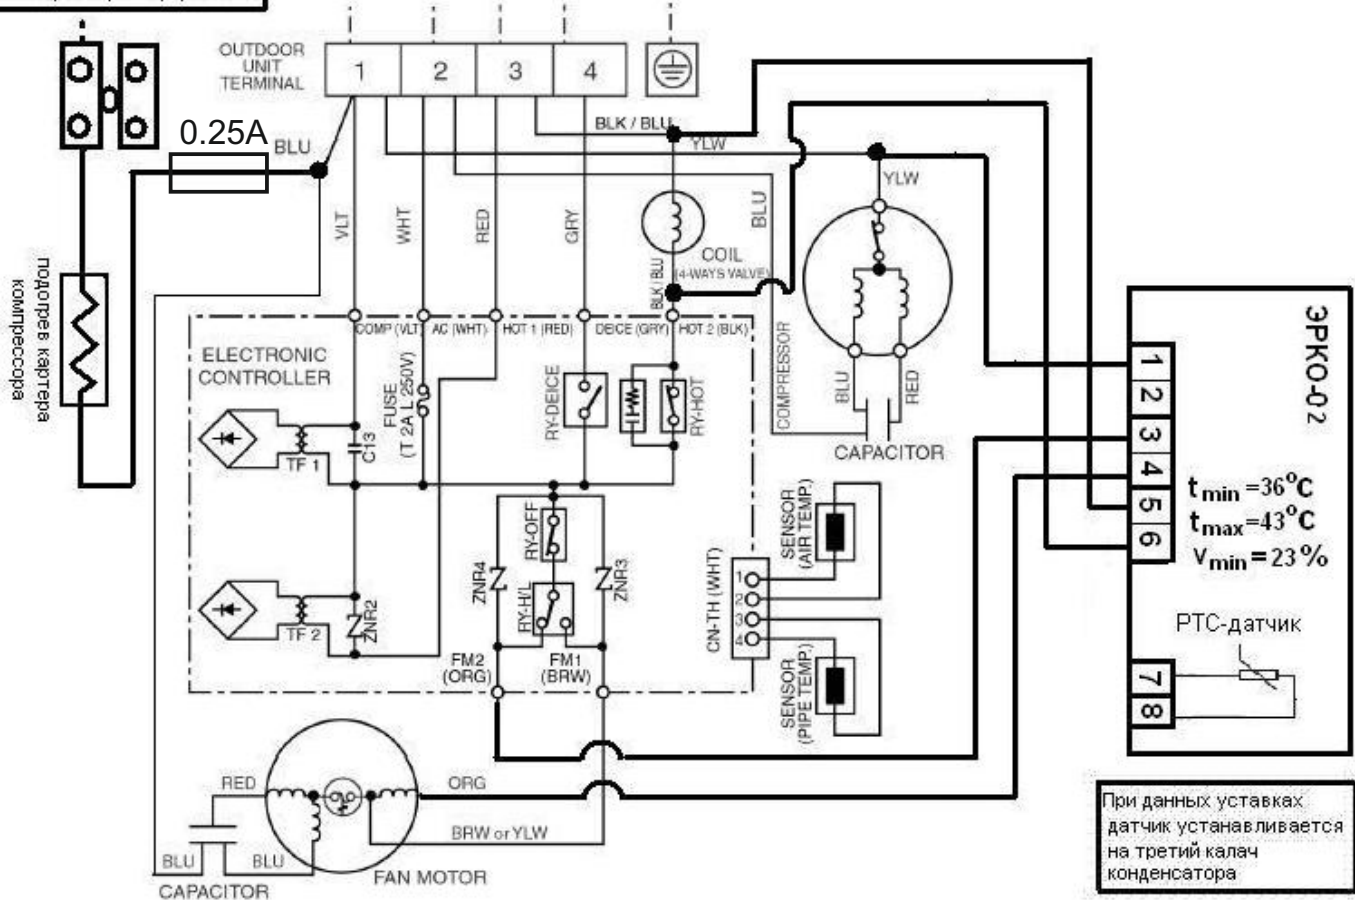

**Remarks:**

- |    |         |     |                  |
|----|---------|-----|------------------|
| B  | : BLUE  | R   | : RED            |
| BR | : BROWN | O   | : ORANGE         |
| BL | : BLACK | P   | : PINK           |
| W  | : WHITE | V   | : VIOLET         |
|    |         | GR  | : GRAY           |
|    |         | Y/G | : YELLOW / GREEN |

**Resistance of Compressor Windings**

MODEL	CU-A18CKE	CU-A24CKE
CONNECTION	2JS324D3AB07	2JS438D3JA02
C - R	1.415 Ω	0.803 Ω
C - S	2.407 Ω	2.053 Ω

Note: Resistance at 20°C of ambient temperature.